

**QUARTERLY REPORT
FOR THE
ROCKY FLATS GROUNDWATER PLUME
TREATMENT SYSTEMS**

October through December 2001

December 31, 2001



**ADMIN RECORD
SW-B-000031**

DOCUMENT CLASSIFICATION
REVIEW WAIVER PER
CLASSIFICATION OFFICE

CEX-072-99

TABLE OF CONTENTS

1 0	INTRODUCTION	1
1 1	Site Events	1
2 0	SOLAR PONDS PLUME TREATMENT SYSTEM	1
2 1	Project Status	3
2 2	Treatment Effectiveness	3
2 2 1	Treatment System Monitoring	4
2 2 2	Downgradient Water Quality	4
2 3	Conclusions and Planned Changes	6
3.0	PU&D YARD PLUME TREATABILITY STUDY	7
3 1	Project Events	7
3 2	Preliminary Results	10
3 3	Conclusions and Work Planned	13
4.0	REFERENCES	13

TABLES

Table 1	Solar Ponds Plume Treatment System Analytical Results	4
Table 2	Downgradient Water Quality	5
Table 3	Recent Uranium Activities at the Pond A-4 Point-of-Compliance	6
Table 4	Preliminary Treatability Study Results	10

FIGURES

Figure 1	Solar Ponds Plume Treatment System Locations	2
Figure 2	PU&D Yard Groundwater VOC Plume Project Area	8
Figure 3	PU&D Yard Groundwater VOC Plume Material Insertion Point Configuration	9

GRAPHS

Graph 1	Solar Ponds Plume Treatment System Flow Rates, January through March 2001	3
Graph 2	Nitrate Concentrations at the Solar Ponds Plume Treatment System	5
Graph 3	Tetrachloroethene and Degradation Products Concentration versus Time in 30900	11
Graph 4	Tetrachloroethene and Degradation Products Concentration versus Time in 31001	11
Graph 5	Mole Fraction of Tetrachloroethene Relative to its Degradation Products as a Function of Time	12

ACRONYM LIST

DOE	Department of Energy
gpm	gallons per minute
ITS	Interceptor Trench System
HRC®	Hydrogen Release Compound®
MIP	Material Insertion Point
msl	mean sea level
mg/l	milligrams per liter
OU	Operable Unit
PCE	Tetrachloroethene
pCi/l	picoCuries per liter
PU&D	Property Utilization and Disposal
RFCA	Rocky Flats Cleanup Agreement
RFETS	Rocky Flats Environmental Technology Site
SCFA	DOE Subsurface Contaminant Focus Area
TCE	Trichloroethene
ug/l	micrograms per liter
VOCs	volatile organic compounds

1.0 INTRODUCTION

This quarterly report describes the activities and available performance monitoring data for the Solar Ponds Plume groundwater collection and treatment system and the Property Utilization and Disposal Yard (PU&D Yard) Plume Treatability Study at the Rocky Flats Environmental Technology Site (RFETS). As required by the respective decision documents, the remaining groundwater collection and treatment systems are now sampled semi-annually.

The Annual Report prepared at the end of each calendar year will include available data for all five groundwater collection and treatment systems. This report will include the reactive barriers for the Mound Site Plume, the East Trenches Plume and the Solar Ponds Plume, Operable Unit (OU) 1 – 881 Hillside system, and OU7 – Present Landfill Seep collection system. The PU&D Yard Plume Treatability Study results will also be summarized in the Annual Report.

1.1 Site Events

No events impacting the plume treatment systems occurred this quarter. However, little precipitation was received this quarter resulting in low flow rates for the plume treatment systems.

2.0 SOLAR PONDS PLUME TREATMENT SYSTEM

The Solar Ponds groundwater plume contains low levels of nitrate and uranium generally attributed to storage and evaporation of radioactive and hazardous liquid wastes in the Solar Evaporation Ponds from 1953 to 1986. These ponds were drained and the sludge removed by 1995. Six interceptor trenches were installed in 1971 to de-water the hillside north and downgradient of the ponds. The original six trenches were abandoned in place, and the Interceptor Trench System (ITS) was installed in 1981. The ITS was replaced with a 1,100-foot long collection system and passive treatment cell containing iron and wood chips in September 1999. The system components are shown on Figure 1. This system intercepts the water previously collected by the now defunct ITS.

The original system design placed the treatment cell adjacent to North Walnut Creek. With this design, water intercepted by the collection trench would flow by gravity to the treatment cell without detention in the collection trench. Because Preble's Meadow Jumping Mouse (a Federally Listed Threatened Species) is present at this optimal location for a flow-through treatment cell, the location of the treatment cell was moved 400 feet upgradient to a location immediately adjacent to the collection trench. As a result, the collection trench for this system must hold approximately 11 feet of groundwater to develop sufficient hydraulic head for the groundwater to flow into the treatment cell. This has reduced the amount of water treated.

Maintenance requirements consist of water level monitoring and sample collection. Based on information from other similar systems, the media does not require raking or other maintenance. It is expected that media replacement will be required 10 years after installation.

2.1 Project Status


The Solar Ponds Plume system is currently collecting groundwater containing nitrate and uranium from the Solar Ponds Plume. However, some untreated groundwater is also reaching surface water at the discharge gallery. This results in higher nitrate and uranium levels in North Walnut Creek than were observed prior to system installation.

Surface water quality continues to be well below applicable standards of 10 picoCuries per liter (pCi/l) uranium and 100 milligrams per liter (mg/l) nitrate specified in the Solar Ponds Plume Decision Document (DOE 1999). The 100 mg/l nitrate standard is a temporary modification of the underlying stream standard of 10 mg/l nitrate in North Walnut Creek (DOE 1999).

2.2 Treatment Effectiveness

Treatment system flow and volume of water are measured and recorded automatically. The daily flow volume treated for the period October through December 16, 2001 are shown in Graph 1. The flow rate this quarter ranged from 0 to 0.9 gallons per minute. As of December 16, 2001, approximately 451,885 gallons of water have been treated since system installation. Of this volume, 435 gallons were treated this quarter.

Graph 1 Solar Ponds Plume Treatment System Flow Volume, October through December 2001

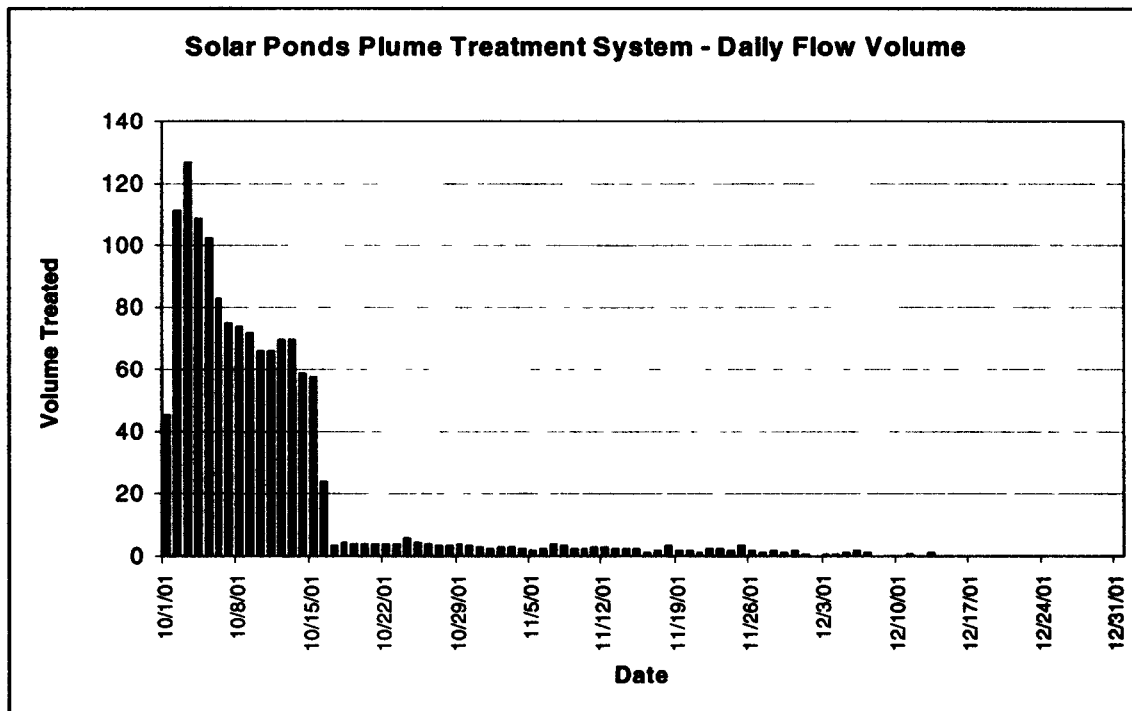

Water levels within the collection trench and downgradient wells are monitored monthly at locations shown on Figure 1. This information will be provided in the Groundwater Plume Treatment Systems 2001 Annual Report (in progress).

2.2.1 Treatment System Monitoring

Monthly samples are collected from the treatment system influent, effluent and discharge gallery (Figure 1) and available data for 2001 are provided in Table 1. Influent and discharge gallery nitrate concentrations in October and November were above average, most likely because of drier conditions. However, uranium activities are not as elevated. Discharge gallery nitrate concentrations are similar to those seen in August 2000 samples, another dry period. The November influent nitrate concentration of 212 mg/l is the highest concentration seen to date at this location. Low flow rates during this quarter did not allow for collection of effluent samples.

Table 1 Solar Ponds Plume Treatment System Analytical Results

Collection date	SPP Influent		SPP Effluent		SPP Discharge Gallery	
	Nitrate in mg/l	Total Uranium in pCi/l	Nitrate in mg/l	Total Uranium in pCi/l	Nitrate in mg/l	Total Uranium in pCi/l
30-Jan-01	140	25.06	-	-	130	25.66
26-Feb-01	150	26.44	-	-	140	24.51
19-Mar-01	120	25.58	0.07	0.15	110	28.84
13-Apr-01	140	24.43	<0.05	0.003	120	20.2
25-Apr-01	130	24.58	<0.05	0.05	130	28.55
3-May-01	110	24.82	0.13	0.091	150	24.79
8-May-01	150	23.66	5.3	0.11	140	26.6
23-May-01	130	27.97	<0.05	0.002	180	31.16
21-Jun-01	120	25.49	<0.05	0.168	220	50.38
16-Jul-01	150	21.3	0.11	0	130	55.4
10-Aug-01	140	24.51	<0.05	0.1	150	28
26-Sep-01	109	26.22	-	-	202	41.64
31-Oct-01	168	22.64	-	-	257	37.15
30-Nov-01	212	nr	-	-	268	nr

- not sampled
nr – not received

It appears that the discharge gallery is discharging both groundwater that is bypassing the treatment cell, and groundwater derived from the pre-existing downgradient part of the plume that has nitrate concentrations consistently above 500 mg/l. This downgradient part of the plume is contributing to the higher nitrate and uranium concentrations at the discharge gallery than are observed at the treatment system influent.

2.2.2 Downgradient Water Quality

Surface water and groundwater are monitored at several locations downgradient of the collection and treatment system. Groundwater quality will be reported in the Groundwater Plume Treatment Systems 2001 Annual Report (in progress).

2.2.2.1 Surface Water Quality

Surface water monitoring stations at GS13 and Pond A-3 are monitored monthly to verify that existing stream standards continue to be met. Monitoring data for 2001 are provided in Table 2 below. Nitrate concentrations are well below the temporary stream standard of 100 mg/l and

uranium activities at GS13 are below the surface water standard of 10 pCi/l Nitrate concentrations and uranium activities are elevated this quarter, but are similar to values observed during other dry periods


Table 2 Downgradient Surface Water Quality

	GS13		Pond A-3
Collection date	Nitrate in mg/l	Total Uranium in pCi/l	Nitrate in mg/l
30-Jan-01	20	9 15	7 9
26-Feb-01	18	8 85	11
19-Mar-01	13	5 89	8 2
13-Apr-01	7 8	2 999	4 1
25-Apr-01	10	2 936	5 4
3-May-01	2 9	1 328	4 5
8-May-01	12	4 08	5 3
23-May-01	15	5 53	5 6
21-Jun-01	4 3	2 33	2 9
16-Jul-01	11	3 71	2 2
10-Aug-01	8 9	4 4	1 5
26-Sep-01	27 4	9 18	1 9
31-Oct-01	26 5	8 02	4 9
30-Nov-01	20 2	nr	7
Standards	100	10	100

nr – not received

Graph 2 below displays the surface water nitrate data since installation of the Solar Ponds Plume system along with concentrations observed at the discharge gallery The graph also shows that even with the recent elevated concentrations, there is an overall decreasing trend in discharge gallery nitrate concentrations

Graph 2 Nitrate Concentrations at the Solar Ponds Plume Treatment System

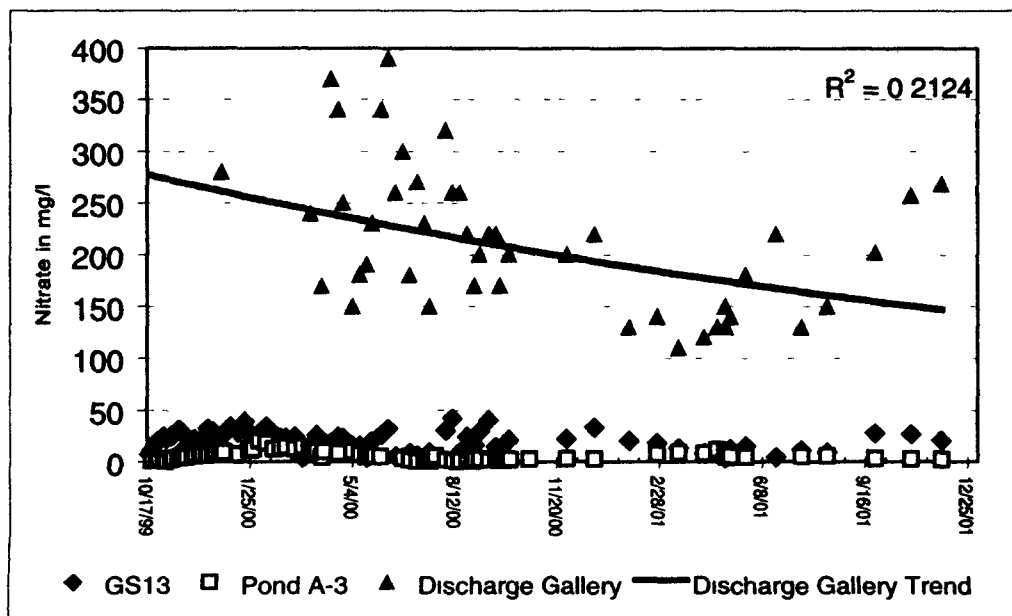

GS13 is the performance monitoring location for the Solar Ponds Plume System (DOE 1999) and is located in North Walnut Creek immediately downgradient of the Solar Ponds Plume. Since January 2001, the nitrate concentrations have generally been below 20 mg/l but fluctuate depending upon precipitation and other factors. For this quarter, the nitrate concentration ranged from 20.2 to 27.4 mg/l, the highest level seen this year. So far in calendar year 2001, the 85th percentile concentration of nitrate is 20.5 mg/l. This is a 30% reduction over the calendar year 2000 85th percentile nitrate concentration of 29.3 mg/l. The annual 85th percentile values will be compared again when data for the complete calendar year 2001 are received (a December result is still pending).

At Pond A-3, located downstream of GS13, nitrate concentrations are now generally below 10 mg/l. Nitrate concentrations this reporting period ranged from 4.9 to 7 mg/l nitrate.

The Pond A-4 Outfall (GS-11) is a Rocky Flats Cleanup Agreement (RFCA) Point of Compliance for uranium. Samples are collected during the Pond A-4 discharge events and usually contain 3 to 4 pCi/l total uranium, well below the stream standard of 10 pCi/l. The most recent Pond A-4 discharge was August 16 to 24, 2001, uranium data from the pre-discharge sample and discharge samples are shown in Table 3 and are well below the 10 pCi/l stream standard.

Table 3 Recent Uranium Activities at the Pond A-4 Point-of-Compliance (pCi/l)

Dates	U-233, 234	U-235	U-238	Total Uranium
7/30/01	1.07	0.03	0.66	1.76
8/16/01 to 8/19/01	0.93	0.05	0.90	1.88
8/19/01 to 8/22/01	0.95	0.03	0.92	1.9
8/22/01 to 8/24/01	0.79	0.05	0.85	1.69

2.2.2.2 Groundwater Quality

Analytical samples are collected quarterly from the two downgradient wells. These data are provided in the Groundwater Plume Treatment Systems 2001 Annual Report (in progress).

2.3 Conclusions and Planned Changes

The treatment cell is performing as designed. However, water levels in the collection trench fluctuate rather than maintaining constant head at 11 feet suggesting that water is bypassing the treatment system. Water quality in North Walnut Creek continues to be well below applicable standards for nitrate and uranium despite apparent bypass of the treatment system.

Water levels within the collection trench and nearby wells will continue to be monitored on a monthly basis. Based on the results from over 2 years of monitoring data, sampling will now be conducted quarterly at groundwater wells, GS13, Pond A-3, the treatment system influent, effluent and discharge gallery to measure system performance and the impact to surface water.

3.0 PU&D YARD PLUME TREATABILITY STUDY

A plume of volatile organic compound (VOC) contaminated groundwater is derived from a contaminant source located in the PU&D Yard at RFETS. Investigation results indicate that subsurface VOC contamination is present in only a few locations and that the primary contaminant is tetrachloroethene (Kaiser-Hill 2001).

A treatability study is in progress to evaluate the effectiveness of Hydrogen Release Compound® (HRC®) for enhancing natural attenuation of the VOCs in the groundwater and soil at the PU&D Yard Plume. HRC® is a proprietary, environmentally safe, food quality, polylactate ester formulated for slow release of lactic acid upon hydration. The HRC® is expected to stimulate rapid degradation of chlorinated VOCs found in groundwater and soil at this location by making low concentrations of hydrogen available to the resident microbes to use for dechlorination. The HRC® is expected to be a one-time application. According to the manufacturer (Regenesis), the material is expected to stimulate contaminant degradation at the project site for approximately one year and a half.

The product has been used at other sites to stimulate rapid degradation of chlorinated VOC contaminants in groundwater and soil. This study is evaluating the effectiveness of HRC® in the low-flow groundwater regimes common at RFETS (Kaiser-Hill 2001). This project is a cooperative effort between RFETS and the Department of Energy (DOE) Subsurface Contaminant Focus Area (SCFA) and funding is provided by DOE SCFA.

3.1 Project Events

The treatability study is located within the source area and that portion of the PU&D Yard Plume exhibiting the highest contaminant concentrations (Figure 2). Monitoring well 30900 was installed in this area immediately adjacent to borehole 17497 where the highest concentrations of VOCs in soils were detected. An additional monitoring well (31001) was installed slightly downgradient of the source area in January 2001 as part of this study. Baseline samples were collected from these two monitoring wells prior to insertion of the HRC®.

Beginning in February 2001, 16 material insertion points (MIPs) were used to place over 800 pounds of HRC® into the subsurface. A 10 feet by 6 feet grid was used for material insertion and was located within the source area of the plume immediately surrounding borehole 17497 (Figure 3). The initial grid consisted of nine points, additional geoprobe boreholes used as material insertion points were spaced between these initial locations biased to the upgradient part of the source area. HRC® insertion was completed on March 1, 2001. Subsurface conditions were allowed to stabilize for two months, then monthly sampling was initiated April 30, 2001.

Groundwater samples were to be collected from the northwest and southwest corners of the insertion grid as possible (Kaiser-Hill 2001). Sufficient groundwater was present at southwest corner of the insertion grid (MIP3) to collect a groundwater sample prior to insertion of the HRC®. There was insufficient water encountered at the northwest corner of the insertion grid (MIP1) to collect a groundwater sample at this location.

Figure 2
PU&D Yard
Groundwater VOC Plume
Project Area

- EXPLANATION**
- PU&D Yard Monitoring Well
 - Groundwater Monitor Well
 - UHSU Surface Material
 - Groundwater Monitor Well
 - UHSU Bedrock
 - Groundwater Monitor Well
 - UHSU Bedrock
 - Borehole Locations
 - Abandoned Monitor Well
 - Material Insertion Point
 - ◆ Composite VOC Groundwater Plume (concentration equal to MCL)
 - PU&D Yard IHSS

- Standard Map Features**
- Buildings and other structures
 - Landfill Pond
 - Stream, ditches or other drainage features
 - Fences and other barriers
 - Topographic Contour (5 Foot)
 - Paved roads
 - Dirt roads

Scale = 1" = 2570'
 1 inch represents approximately 214 feet

10' 0' 100' 200'


State Plane Coordinate Projection
 Colorado Central Zone
 Datum: NAD27

U.S. Department of Energy
 Rocky Flats Environmental Technology Site

Prepared by
DynCorp
 2200 E. 17th Avenue
 Suite 200
 Denver, CO 80202

Prepared for
U.S. DEPARTMENT OF ENERGY
 ROCKY FLATS ENVIRONMENTAL TECHNOLOGY SITE

MAP ID: 01-0004
 September 24, 2001

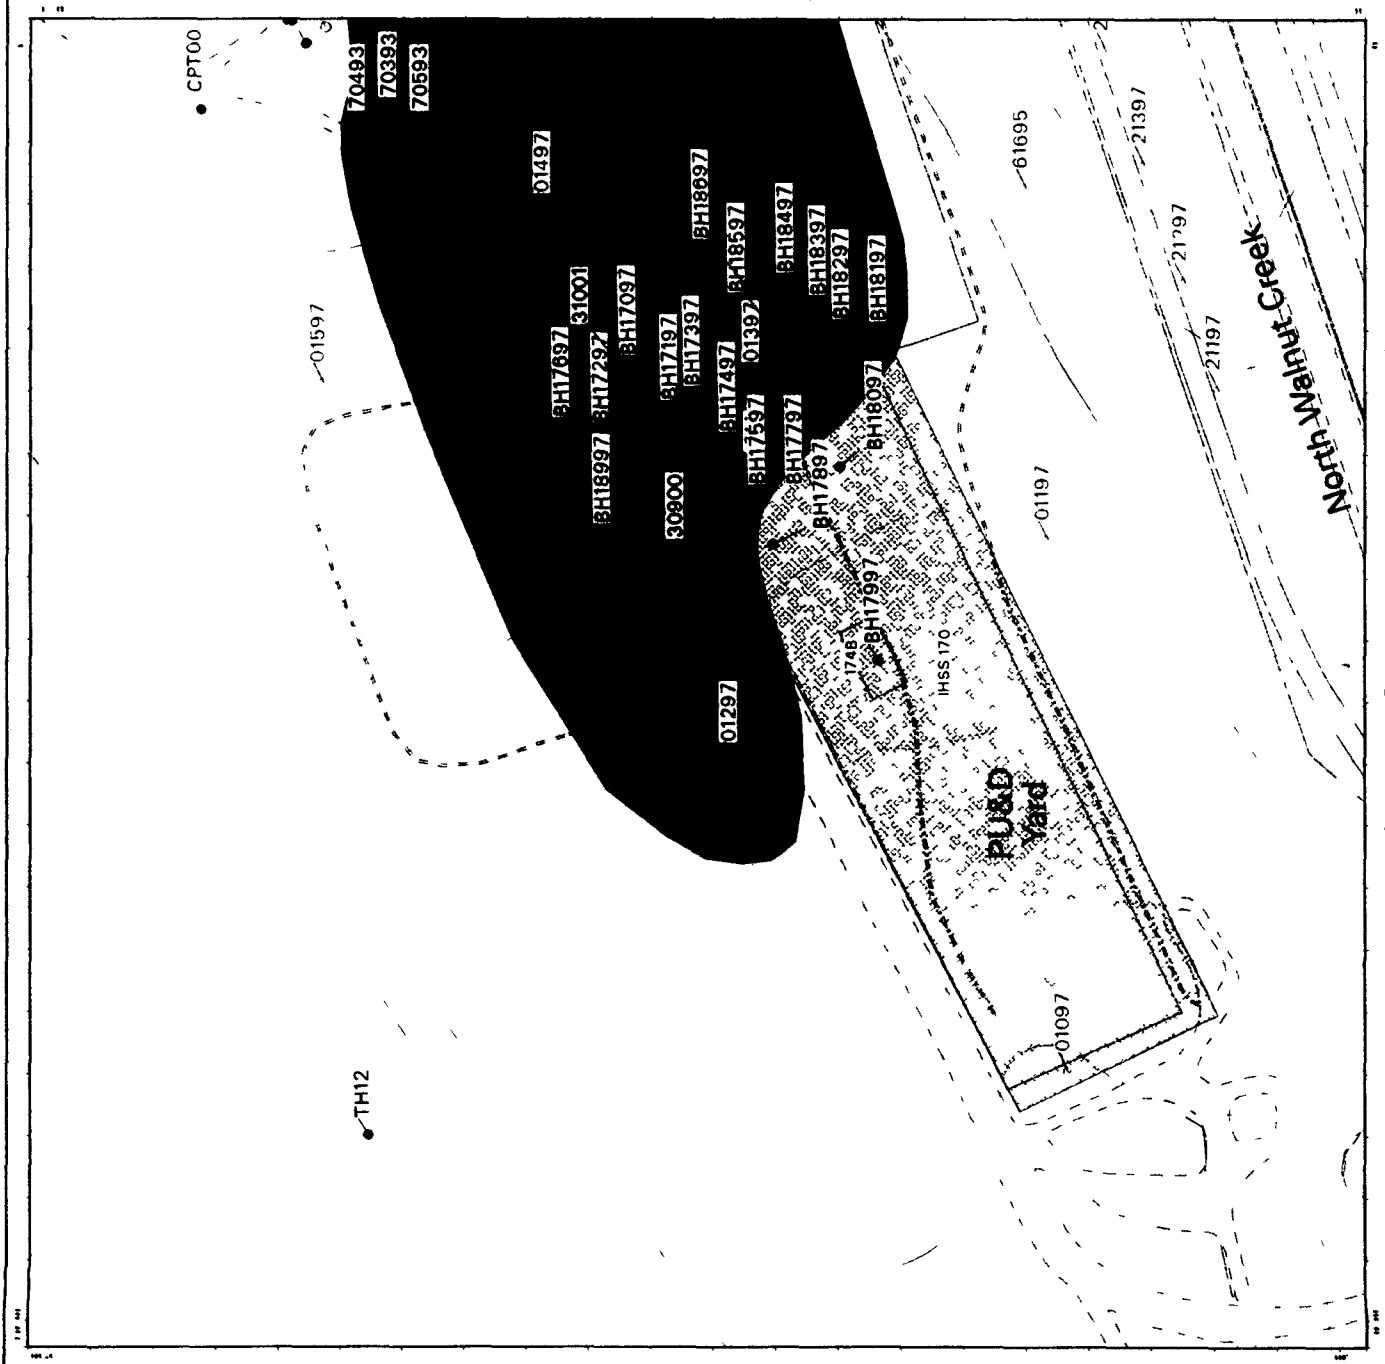



3.2 Preliminary Results

Results from the initial baseline samples and the monthly sampling events through late November 2001 are reported below in Table 4. For completeness, the previous samples from the pre-existing monitoring well (30900) in the source area are also included. In addition, results from the one time only groundwater sample from MIP3 are also shown below.


Table 4 Preliminary Treatability Study Results (in micrograms per liter (ug/l))

Location	Sample Date	Tetrachloroethene	Trichloroethene	Cis 1,2 Dichloroethene	Trans 1,2, Dichloroethene	1,1-Dichloroethene	Vinyl Chloride
MIP3	2/20/01	4.9	ND	ND	ND	ND	ND
30900	10/21/00	96	7.4	53.1	ND	ND	ND
	2/7/01	120	7	78	0.5	0.5	ND
	4/30/01	180	11	110	0.1	0.4	ND
	5/30/01	350	23	210	ND	ND	ND
	6/27/01	240	15	140	0.2	0.5	ND
	7/31/01	93.6	10.6	91.4	0.19	0.31	0.21
	8/28/01	116	15	100	ND	0.39	ND
	10/1/01	50	5	77	ND	ND	ND
	10/31/01	34	3.1	36	ND	ND	ND
	11/29/01	30	3.6	45	ND	0.28	ND
31001	2/7/01	18	5.5	1.2	ND	2.6	ND
	4/30/01	130	20	52	0.1	4	ND
	5/30/01	41	18	4	ND	ND	ND
	6/27/01	120	25	38	ND	1	ND
	7/31/01	105	16.3	189	0.13	1.49	0.12
	8/29/01	81	22	93	ND	ND	ND
	10/1/01	67	7.7	71	ND	0.6	ND
	11/1/01	18	4.8	30	ND	0.65	ND
	11/30/01	15	3.7	24	ND	0.47	ND
Groundwater Tier I Action Levels		500	500	700	700	700	200
Groundwater Tier II Action Levels		5	5	7	7	7	2

ND - not detected


As shown in Table 4 and on Graph 3, concentrations of tetrachloroethene, trichloroethene and cis-1,2 dichloroethene in the source area well (30900) increased after insertion of the HRC®, then decreased. Trichloroethene and cis-1,2 dichloroethene are common degradation products of tetrachloroethene. According to Regenes (the HRC® manufacturer), approximately 70% to 80% of project sites see an initial increase in VOC concentrations before a downward trend is observed. As shown below, this downward trend has continued as was predicted.

Graph 3 Tetrachloroethene and Degradation Products Concentration versus Time in 30900

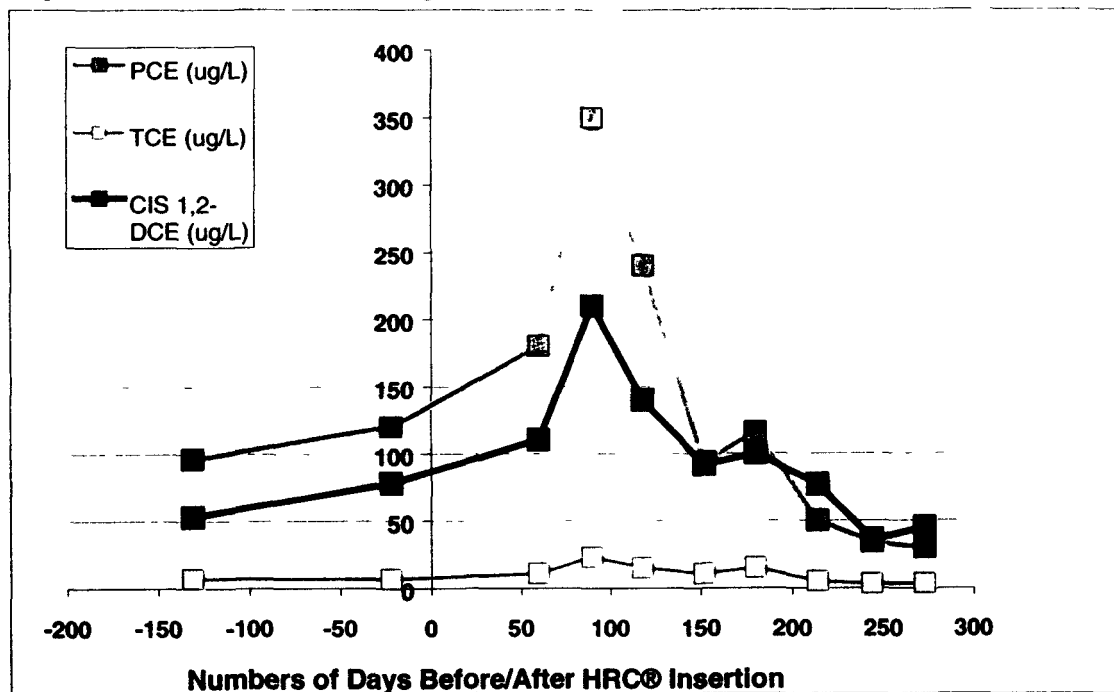

As shown on Graph 4, data from Well 31001 show a similar pattern with the exception of the sample taken on May 30, 2001 (Day 90) that had lower than anticipated volatile organic values. It is possible that there are problems with this sample although no errors could be found in the sample documentation.

Graph 4 Tetrachloroethene and Degradation Products Concentration versus Time in 31001

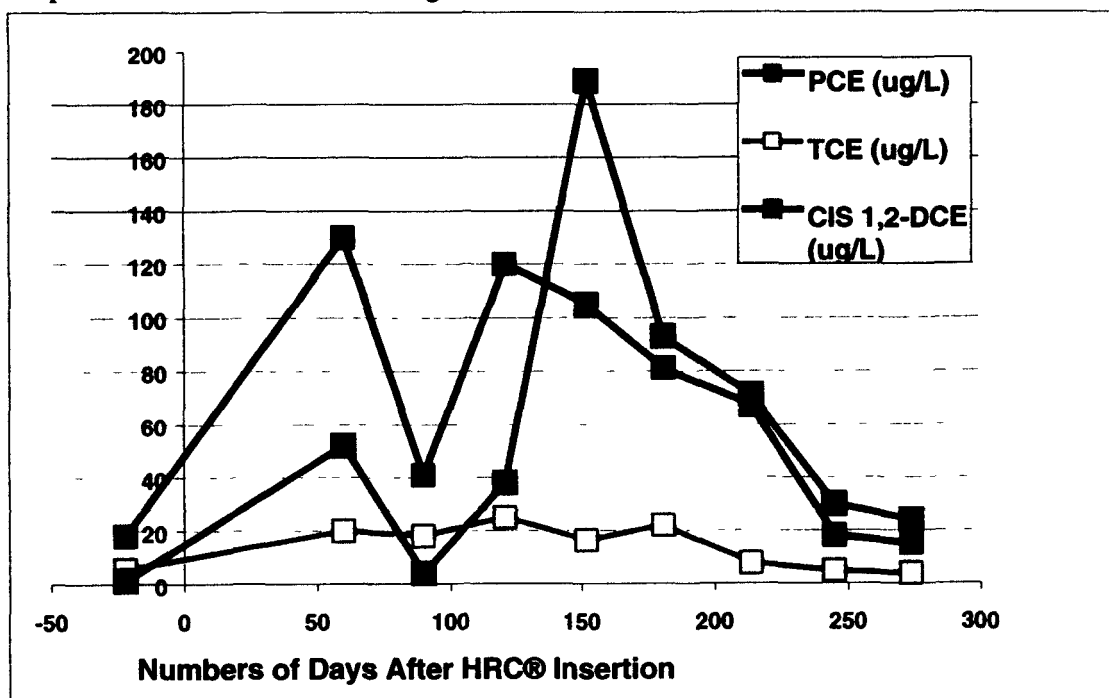

The initial increase in tetrachloroethene groundwater concentrations was most likely due to one or a combination of the following conditions


- A change in the surface tension of free phase solvents in the pores that would cause more solvent to be released from the pores
- A change in the relative solubility of the individual VOCs due to the presence of the lactic acid in the aqueous phase that would allow more VOCs to go into solution
- Other changes in liquid and organic phases caused by changes in pH, temperature, oxidation-reduction potential, etc caused by addition of lactic acid or by increases in biological activity

The initial increases in concentrations indicate that VOCs are being transferred from the soil to an aqueous phase, potentially accelerating both soil and water remediation. Typically, the VOCs trapped in soil below the saturated zone have been the most difficult phase to remediate and continue to act as a contaminant source. If these are being mobilized and then biologically degraded along with the dissolved phase this will be a much more robust treatment methodology than simply biologically degrading the dissolved fraction.

As shown in Table 4, the presence of other degradation products such as trans 1,2-dichloroethene, 1,1-dichloroethene and vinyl chloride demonstrates that degradation is occurring since these contaminants were not associated with releases at the PU&D Yard. Vinyl chloride is the last degradation product generated prior to the degradation to ethene. The small quantities of ethene produced are expected to offgas and not be detected.

The increase in the ratio of degradation products relative to tetrachloroethene concentrations confirms that degradation is occurring. Graph 5 shows the relative changes of mole fractions of tetrachloroethene and its degradation products in 31001. This trend in combination with the overall reduction of tetrachloroethene indicates that even though additional tetrachloroethene was liberated to the aquifer that much of this has been degraded. It is anticipated that over time there will be a further decrease in these degradation products also.

Graph 5 Mole Fraction of Tetrachloroethene Relative to its Degradation Products over Time

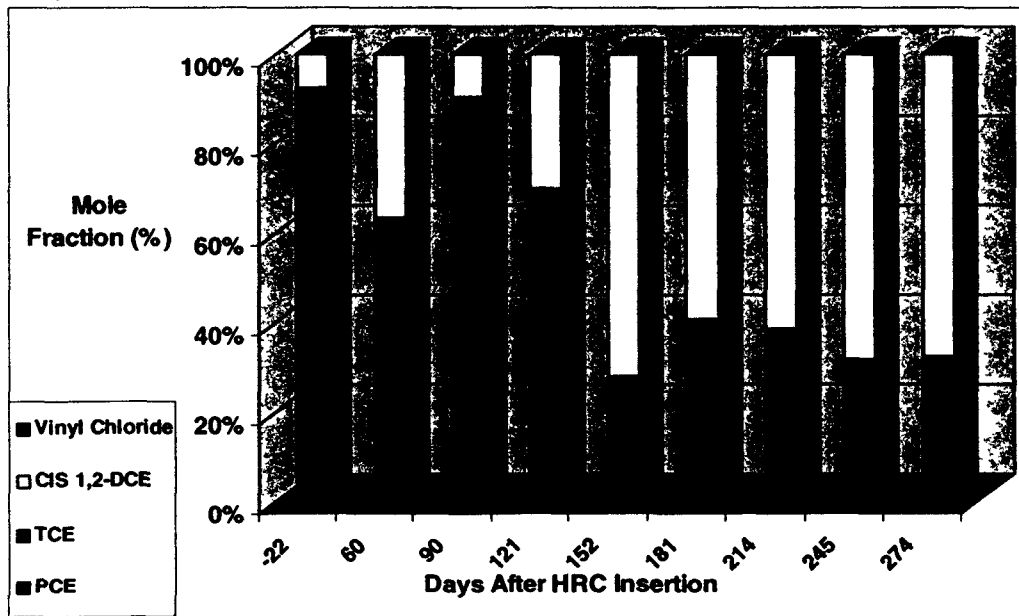

3.3 Conclusions and Work Planned

The continued decrease in tetrachloroethene and appearance of its byproducts provide direct evidence that the contaminant plume is being degraded. However, monthly monitoring will continue until sufficient data are collected to establish the effectiveness of the HRC® and the results will be presented in the Quarterly Plume Reports. A treatability study report was completed in October 2001 and provides additional information on the treatability study (Kaiser-Hill, 2001).

4.0 REFERENCES

DOE, 1999, *Final Solar Ponds Plume Decision Document*, RF/RMRS-98-286 UN, June

Kaiser-Hill, 2001, *Final PU&D Yard Plume Enhanced Natural Attenuation Treatability Study Report*, September

16/16